


HINDMAN TRACT - PART OF SECTION 32 TOWNSHIP 39 NORTH; RANGE 2 EAST

INST. # 2019003917
WASHINGTON COUNTY, MISSOURI



BASIS OF BEARINGS:
GNSS GRID - NAD 83 MO.
STATE PLANE COORD.
SYSTEM

SURVEYOR'S LEGEND


- DENOTES FOUND IRON ROD
- DENOTES SET IRON ROD
- ⊗ DENOTES FOUND IRON PIPE
- ⊠ DENOTES FOUND ALUM. MONU.
- DENOTES FOUND OLD IRON
ROD AND ROCK PILE
- DENOTES FOUND ROCK PILE

LINE	LENGTH	BEARING
L52	161.79	N04°55'38"W
L53	245.73	N16°03'10"W
L54	166.65	N03°18'06"W
L55	54.55	N09°13'48"W
L56	271.34	N17°36'10"W
L57	73.29	N32°34'42"W
L58	112.82	N45°38'28"W
L59	155.80	N59°27'46"W
L60	226.16	N68°13'38"W
L61	144.91	N54°18'22"W
L62	121.64	N41°20'22"W
L63	107.31	N24°29'19"W
L64	132.88	N06°19'58"W
L65	93.03	N17°58'26"W
L66	240.00	N03°43'34"E
L67	293.24	N05°23'02"E
L68	170.33	N10°23'30"E
L69	217.44	N09°26'57"E
L70	183.75	N05°05'43"E
L71	112.80	N04°16'27"E
L72	113.08	N11°22'18"W
L73	181.61	N10°43'34"W
L74	266.15	N15°03'09"W
L75	168.47	N06°40'36"W
L76	249.76	N29°58'09"W
L77	125.29	N39°22'11"W
L104	131.29	N08°25'39"W
L105	215.54	N37°14'00"W
L106	350.21	N35°44'03"W
L107	90.03	N15°21'31"W
L108	115.66	N11°06'31"E
L109	155.64	N13°57'21"E
L110	140.33	N69°01'24"E
L111	270.19	N64°41'54"E
L112	118.62	N51°58'21"E
L113	188.01	N32°08'20"E
L114	162.29	N39°06'37"E
L115	135.69	N38°40'29"E
L116	183.68	N15°53'12"E
L117	16.80	N06°04'41"E
L176	175.58	S68°52'48"W
L177	253.93	S75°58'07"W
L182	17.54	S85°55'11"E

OLD IRON ROD AND
ROCK PILE MARKING
THE NORTHWEST CORNER
OF SEC. 29 T39N;R2E

ROCK PILE MARKING
THE WEST 1/4 CORNER
OF SEC. 29 T39N;R2E


HINDMAN TRACT
7.682 ACRES +/-

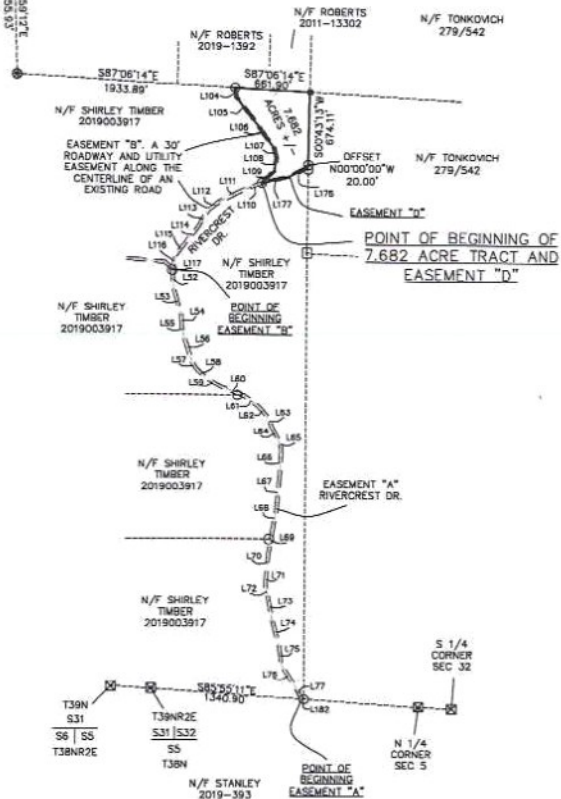

Boundary Survey

This is to certify that at the request of DARRELL W. HINDMAN, we have during DECEMBER, 2020, associated a Boundary Survey. The results reflect the conditions found at the time of the survey, are correctly shown above, and conform to the Current Minimum Standards (effective 12/30/2004) for Rural Class Property Boundary Surveys as issued by the Missouri Department of Natural Resources and the Missouri Board of Architects, Engineers, and Land Surveyors. This survey was conducted under the immediate personal supervision of the undersigned Registered Land Surveyor. The easements, restrictions, and building lines shown are based on record plat information or on information supplied by the client. No investigation has been made by David R. McClain, as to the present status of any easements, restrictions, or building lines, shown or not shown, affecting the tract surveyed.

SCALE



REVISED -

DAVID R. MCCLAIN
380 LONG SPRINGS ROAD
STEELEVILLE, MO 65565
(314) 581-1025

SHEET 1 OF 2

ORDER NO.
DATE
12/23/20

PART OF SECTION 32, T39N;R2E



12/29/2020

DAVID R. MCCLAIN MO.P.L.S. 200105281

DATE